Ship Name: ALEX P Ship Type: Bulk Carrier

IMO Number: 7703558 Flag: Malta

Date Detained: 05/23/2002 Class Society: Bureau Veritas

Port: Big Stone Anchorage, Delaware Company(s): Owners, Operators or Managers

Mistral Shipping Co., LTD.

Deficiencies: <u>Code - Category</u> <u>Description</u>

0740 - Pumps Emergency fire pump unable to take suction

1499 - Other (Prop. & Aux. Ballast pump has excessive leakage at packing

Machinery) gland.

0610 - Lifeboats Stbd lifeboat unable to deploy due to damaged

falls.

0945 - Emergency lighting, etc Emergency power batteries power availablility

inadequate.

0610 - Lifeboats Port lifeboat brake inoperable.

0672 - EPIRB's for survival craft EPRIB arrangement not float -free due to

hydrostatic release in wheelhouse.

0611 - Lifeboat inventory Lifeboat radios inoperable due to expired

batteries

0660 - Lifejackets PFD lights not functional.

0330 - Sanitary facilities
 0310 - Dirty parasites
 0371 - Medical equipment
 Hospital space toilet not operational.
 Insect infestation in crew quarters.
 Stretcher dry rotted and unusable.

0330 - Sanitary facilities Sanitary water not available in crew quarters.

2555 - Documentation Document of Compliance not endorsed.

Ship Name: CSL CABO Ship Type: Bulk Carrier

IMO Number: 7117278 Flag: Liberia

Date Detained: 05/17/2002 Class Society: Lloyd's Register of Shipping

Port: Long Beach, California Company(s): Owners, Operators or Managers

CSL International Inc.

Deficiencies: Code - Category Description

0680 - Embarkation arrangt.

survival craft

Port lifeboat winch inoperable.

Ship Name: ENGIN KAPTANOGLU Ship Type: Bulk Carrier

IMO Number: 7926124 Flag: Turkey

Date Detained: 05/14/2002 Class Society: Lloyd's Register of Shipping

Port: Chesapeake, Virginia Company(s): Owners, Operators or Managers

Izmar Gemi Isletmeciligi

Kaptanoglu Group of Shipping

Deficiencies: Code - Category Description

2555 - Documentation No documentation could be provided for

master's familiarization training prior to

assuming SMS duties.

2525 - Masters responsibility and

authority

Master not familiar with company quality

safety policy and procedures for non-conformity reporting.

2555 - Documentation No documentation could be provided for

familiarization training for second engineer.

2555 - Documentation Document control is not effective: three

control lists exist in Turkish and English language and do not agree with each other.

2510 - Safety and environmental

policy

PSC officer observed hot work on deck and no permit could be provided IAW KGP 7.0/11 hot

work procedures. Last permit filled Oct 2001

on form 19, which had no revision date.

2545 - Reports/analysis of

non-conformities, etc.

Cement patch on main deck in way of containment box installed prior to February 2001. No report made to company and no

non-confomity filed IAW documented

procedures.

1299 - Other (Load Lines) Containment area on main deck port side on

cross deck between no. 4 and no. 5 cargo holds

wasted, holed and temporarily patched

1299 - Other (Load Lines) Deck securing pilot ladder arrangement welds

wasted and cracked and frame separated from

deck.

1230 - Railing cat walks Ladder on cross deck between no. 3 and no. 4

cargo holds and handrails on port side in way

of no. 5 cargo hold wasted.

0899 - Other (accid. prevent.) No. 2 ballast pump suction pipe, outlet piping

of generator heat exchanger and suction piping for no. 1 main engine cooling pump leaking, wasted and temporarily patched.

0230 - Number/composition

(manning)

Chief engineer does not have valid license.

Ship Name: FOREST LINK Ship Type: Ro-Ro-Cargo Ship

IMO Number: 7129623 Flag: Panama

Date Detained: 05/09/2002 Class Society: Lloyd's Register of Shipping

Port: Pascagoula, Mississippi Company(s): Owners, Operators or Managers

Paper Sea AS

Tramarco Holding AS

Deficiencies: Code - Category Description

2035 - Fire control plan Fire control plan is outdated and not in

accordance with ship configuration.

0745 - Fire-dampers remote All fire dampers inoperable, either wasted or

control, etc. incapable of closing.

0725 - Fixed fire extinguishing Seven (7) CO2 bottles that supply machinery

installation and cargo spaces discovered empty.

0720 - Fire fighting equipment Fire hoses missing from fire stations.

0720 - Fire fighting equipment Main through-hull piping for ballast, cooling

& fire-fighting extremely wasted and holed

below engine room deck plates.

0720 - Fire fighting equipment Main deck fire main line holed and severely

wasted and not providing adequate fire

pressure to forward areas.

Ship Name: GAZ DIAMOND Ship Type: LPG Gas Carrier

IMO Number: 8917845 Flag: Panama

Date Detained: 05/20/2002 Class Society: Lloyd's Register of Shipping

Port: Port Angeles, Washington Company(s): Owners, Operators or Managers

Naftomar Shipping and Trading

Deficiencies: Code - Category Description

1720 - Control of discharge of oil Fuel oil transfer valve inoperable resulting in

the release of oil into the navigable waters of

the United States.

2535 - Development of plans for

shipboard operations with ISM code in way of incomplete and

inaccurate documentation and application of fuel-oil transfer procedures and piping

The vessel was found to be in non-compliance

fuel-oil transfer procedures and piping diagram which resulted in the discharge of oil

during bunker operations.

Ship Name: HOSE MARTI Ship Type: Oil Tankship

IMO Number: 7605809 Flag: Liberia

Date Detained: 05/15/2002 Class Society: Bureau Veritas

Port: Bayonne, New Jersey Company(s): Owners, Operators or Managers

Latvian Shipping Co

Deficiencies: <u>Code - Category</u> <u>Description</u>

2550 - Maintenance of ship and Due to deficiencies listed below, inspectors

equipment conducted an expanded exam of the Safety
Management System.and discovered that the
documented maintenance system either does

not exitst or is not readily available.

0610 - Lifeboats Lifeboat parachute signals expired.

0640 - Distress flares Hand flares missing.

0730 - Appliances (general Lifeboat air bottles below the minimum

equipment) pressure.

0740 - Pumps Emergency fire pump exhaust leaking

excessively.

Ship Name: KALISTI Ship Type: Bulk Carrier

IMO Number: 7920027 Flag: Greece

Date Detained: 05/02/2002 Class Society: Lloyd's Register of Shipping

Port: New Orleans, Louisiana Company(s): Owners, Operators or Managers

Tomazos Shipping Co. Ltd Galini Maritime Company

Deficiencies: Code - Category Description

2510 - Safety and environmental Expanded audit conducted on vessel's Safety

policy Management System and found system to be

not in compliance with the Code.

2020 - Fire drills Crew unable to demonstrate proficiency in a

fire drill.

2025 - Abandon ship drills Crew unable to demonstrate proficiency in an

abandon ship drill.

Ship Name: LA LINDA Ship Type: General Dry Cargo Ship

IMO Number: 9060261 Flag: Panama

Date Detained: 05/15/2002 Class Society: Nippon Kaiji Kyokai

Port: Long Beach, California Company(s): Owners, Operators or Managers

Southern RT Maritime S.A.

Deficiencies: <u>Code - Category</u> <u>Description</u>

0999 - Other (Safety In General) Salt water cooling piping wasted and leaking.

0945 - Emergency lighting, etc Emergency generator inoperable

0745 - Fire-dampers remote Fire doors held open/wasted and would not

control, etc.

0696 - Record of Port lifeboat davits inoperable.

inspections/maintenance

Ship Name: MSC INSA Ship Type: Containership

IMO Number: 7121243 Flag: Panama

Date Detained: 05/01/2002 Class Society: Germanischer Lloyd

Port: **Baltimore**, **Maryland** Company(s): Owners, Operators or Managers

Mediterranean Shipping Co. S.A.

Ficanto Corporation

Deficiencies: <u>Code - Category</u> <u>Description</u>

0999 - Other (Safety In General) Foundations for No. 1 & No. 2 ship's service

generator's auxiliary cooling salt water

pumps severely wasted.

0999 - Other (Safety In General) Main engine seawater line on port side of

engine room wasted with temporary soft patch

installed.

0999 - Other (Safety In General) Main salt water pumps have excessively wasted

foundations

0999 - Other (Safety In General) Foundations for seawater suction strainer on

starboard side severely wasted and almost

non-existant.

0999 - Other (Safety In General) Shaft bearing cooling water pipe wasted at

elbow before pipe penetrates watertight

bulkhead leading to shaft alley.

1730 - Oily-water separating

equipment

Oil dispersants/surfactants witnessed being used in engineroom bilge during inspection, which inhibits proper operation of the OWS.

Vessel not to operate OWS until Class attests

to proper operation.

0730 - Appliances (general

equipment)

Fire main wasted/holed forward port side.

1240 - Cargo and other hatchways Hatch combing brackets fractured between

cargo holds No. 3 & No. 4.

0610 - Lifeboats Port and starboard lifeboats severely

wasted/holed. Lifeboats appear to be beyond

their servicibility.

Ship Name: **PERLA II** Ship Type: General Dry Cargo Ship

IMO Number: 7718204 Flag: Panama

Date Detained: 05/16/2002 Class Society: American Bureau of Shipping

Port: New Orleans, Louisiana Company(s): Owners, Operators or Managers

Mikeala Shipping Company Ltd.

Deficiencies: Code - Category Description

> 0220 - Certificates of competency Master of vessel does not have a valid national

> > license or flag state endorsement.

0230 - Number/composition Vessel not manned in accordance with

(manning) minimum safe manning document.

Ship Name: **RABROS** Ship Type: General Dry Cargo Ship

Flag: Panama IMO Number: 8728490

Date Detained: 05/09/2002 Class Society: Bureau Veritas

> Port: New Orleans, Louisiana Company(s): Owners, Operators or Managers

> > Navesco S.A.

Deficiencies: Code - Category Description

> 1430 - Auxiliary engines No. 1 main engine governor removed and is

> > being governed with wood shims in rack.

0940 - Ballast fuel and other tanks No. 1 main engine no. 3 high-pressure fuel line

has unsatisfactory welded repair.

1499 - Other (Prop. & Aux. No. 2 main engine raw water pump is missing.

Machinery)

1499 - Other (Prop. & Aux. Main seawater pipe to engine room has cement

patch inboard of sea chest valve. Machinery)

1499 - Other (Prop. & Aux. Port main shaft packing leaking

Machinery) approximately 1.5 gallons per minute.

0735 - Personal equipment - fire Vessel does not have the required number of

self-contained breathing apparatus spare fighting

bottles.

Ship Name: **STEEL GLORY** Ship Type: **Bulk Carrier**

IMO Number: Saint Vincent and the Grenadines 8309335

Date Detained: 05/29/2002 Class Society: Bureau Veritas

> Port: New Orleans, Louisiana Company(s): Owners, Operators or Managers

> > Horizon Shipmanagement S.A.

Enterprise Shipping & Trading S.A.

Deficiencies: Code - Category

2525 - Masters responsibility and

Vessel's master was found intoxicated on two separate occasions and unable to perform his authority

Description

duties. This is in direct violation of the company's drug and alcohol policy and his responsibilites as prescribed in the safety

management manual.

Ship Name: YEOCOMICO Ship Type: General Dry Cargo Ship

IMO Number: 8310059 Flag: Bahamas

Date Detained: 05/06/2002 Class Society: American Bureau of Shipping

Port: Port Everglades, Florida Company(s): Owners, Operators or Managers

Y-II Shipping Co, Ltd.

Deficiencies: Code - Category Description

1499 - Other (Prop. & Aux. Inoperable bow thruster.

Machinery)

0740 - Pumps Emegency fire pump inoperable.

0135 - Minimum safe manning Vessel not manned IAW the Safe Manning

certificate Certificate.